
912 | 914 ENGINE

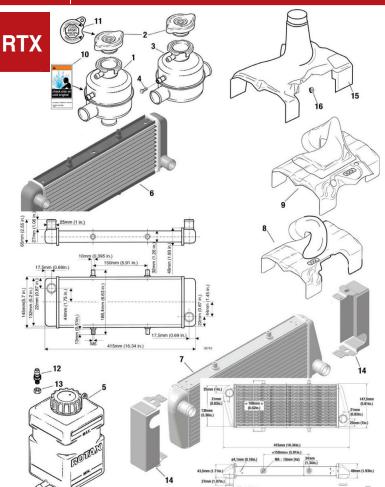

COOLING AIR BAFFLE, OVERFLOW BOTTLE WITH CAP, RADIATOR

Item No.	Part No	Description	Qty. Req.	Price
1-2	922-312	EXPANSION TANK ASSEMBLY 90°	(1)	\$148.00
1-2	922-313	EXPANSION TANK ASSEMBLY 90°	(1)	\$148.00
2-3	922-317	EXPANSION TANK ASSEMBLY 180°	(1)	\$148.20
2-3	922-318	EXPANSION TANK ASSEMBLY 180°	(1)	\$148.20
2	922-072	RADIATOR CAP WITH GASKET	1c	\$82.46
4	641-071	HEX. SCREW ISO M6x6	AR	\$1.43
5	922-327	OVERFLOW BOTTLE WITH CAP	(1)d	\$53.40
6	995-698	RADIATOR - STANDARD 12 FINS	(1)	\$487.00
7	997-084	RADIATOR - ADVANCED 13 FINS	(1)f	\$487.00
8	975-795	COOLING AIR BAFFLE	(1)a	\$614.86
8	975-799	COOLING AIR BAFFLE	(1)j	CALL
10	897-506	WARNING LABEL	1	\$5.69
11	898-490	WARNING LABEL EVANS COOLANT	(NB)	\$0.31
12	940-558	HOSE NIPPLE M6	1d	\$26.39
13	242-213	HEX. NUT M6	1d	\$1.58
14	881-530	RADIATOR RETROFIT KIT	1g	CALL
15-16	975-792	COOLING AIR BAFFLE	(1)h	CALL
15-16	975-798	COOLING AIR BAFFLE	(1)i	CALL
16	975-799	RUBBER GUMMET	(1)	CALL

- Items not illustrated
- a Short version; marked with S/N; tractor, white
- Edition Diamond Marked with S/N;
- See Service Instruction SI-912-020 / SI-914-022 current issue
- See Service Bulletin SB-912-039 / SB-914-029 current issue
- See Service Bulletin SB-912-043 / SB-914-029 current issue
- Same outline dimensions and brackets as TNr. 995-698, but with improved cooling same outline dimensions and brackets as TNr. 99: performance (18 % bigger cooling surface) Use together with part no. 997-083 For retrofitting instead of radiator part no. 997-082 Cooling air baffle for pusher, color white Cooling air baffle for pusher, color black Cooling air baffle for tractor, color black

TURBOCHARGER CONTROL UNIT

TOTIBOOTIATICETI CONTINUE CINT							
Item No.	Part No	Description	Qty. Req. 914 UL	Price			
1	966-494	WIRING HARNESS	1d	\$573.14			
2	966-741	TURBOCHARGER CONTROL	1a	\$2,620.66			
3	295-410	SERVO MOTOR	1b	\$477.51			
4	280-088	ROPE SHEAVE	1	\$108.93			
5	926-180	WASHER A 5.2x14.8x1.5	1	\$0.59			
6	945-830	LOCK WASHER A5	1	\$0.21			
7	441-341	ALLEN SCREW M5x20	1	\$0.48			
8	847-882	CABLE RETAINER	1	\$27.65			
9	239-015	COMPRESSION SPRING 16.9	1	\$4.26			
10	853-845	CLAMP 5-7 MM	1	\$4.95			
11	897-941	CABLE BOWDEN ASSEMBLY	1	\$79.86			
12	966-502	AIRBOX PRESSURE SENSOR	1c	\$245.96			
13	274-051	AMBIENT PRESSURE SENSOR	1d	\$282.07			
14	924-990	HOLDING BRACKET FOR	1dh	\$7.78			
17	660-771	RUBBER BUFFER 10x15xM4	4	\$29.13			
18	666-012	CONNECTOR CABLE	1g	\$113.70			

- Items not illustrated
- a Version 4.6; used from following engine S/N in serial production: 914 F: von / from S/N 4,420.200 914 UL: von / from S/N 4,417.849 Retrofit at older engines possible according SB/SI;
- Marked with S/N; b Marked with S/N;
- Airbox pressure sensor
- See Service Instruction SI-914-022 current issue
- Only for part no. 966741 (version 4.6)
- For authorized distributors only
- Connector cable, wiring harness part no. 966-492 with sensor part no.
 - See Service Instruction SI-914-022
- h Non certified part

